

CUBBER RESEARCH INSTITUT OF INDIA LIBRARY

ACC No S 136

17 Oct 1984

£ 7.40

BS 903: Part A13: 1983 ISO 1432-1982

UDC 678.4.063:678.01:620.175.251.1

© British Standards Institution, No part of this publication may be photocopied or otherwise reproduced without the prior permission in writing of BSI.

**British Standard** 


# Methods of testing vulcanized rubber

Part A13. Determination of stiffness at low temperature (Gehman test)

[ISO title: Rubber, vulcanized - Low temperature stiffening (Gehman test) - Determination]

Méthodes d'essai des elastomères vulcanisé Partie A13. Détermination de la rigidité à basse température (essai Gehman)

Prüfverfahren für vulkanisierte Elastomere Teil A13. Bestimmung der Steifigkeit bei niedriger Temperatur (Prüfung nach Gehman)



Contents			_
	Page		Page
National foreword	Inside front cover	Tables	
Committees responsible	Back cover	Twist angles for designated values of the relative modulus (RM)	6
Method		2. Values of factor $\mu$ for various ratios of $b/d$	6
0. Introduction	1		
1. Scope and field of application	1	Figure	
2. Apparatus	1		
3. Test piece	2	Apparatus for determination of stiffness	
4. Procedure	4	characteristics	3
5. Number of tests	5		
6. Expression of results	5		
7. Test report	6		

#### National foreword

This British Standard has been prepared under the direction of the Rubber Standards Committee. It is identical with ISO 1432-1982 'Rubber, vulcanized — Low temperature stiffening (Gehman test) — Determination' published by the International Organization for Standardization (ISO).

The 1972 edition of this British Standard was technically equivalent to the first edition of ISO 1432 and, consequently, the main changes in this revision of the British Standard correspond to the changes incorporated in the second edition of ISO 1432 which are described in clause 0.

This edition of BS 903: Part A13 supersedes the 1972 edition which is withdrawn.

Terminology and conventions. The text of the international standard has been approved as suitable for publication as a British Standard without deviation. Some terminology and certain conventions are not identical with those used in British Standards; attention is drawn especially to the following.

The comma has been used as a decimal marker. In British Standards it is current practice to use a full point on the baseline as the decimal marker.

Wherever the words 'International Standard' appear, referring to this standard, they should be read as 'British Standard'.

Additional information. When the apparent torsional modulus is to be calculated (see 6.4) the width and thickness of the test piece are measured by the appropriate method described in BS 903 'Methods of testing vulcanized rubber': Part A38 'Determination of dimensions of test pieces and products for test purposes'.

In UK practice, the standard laboratory temperature is  $23 \pm 2$  °C (see 3.2.3).

Textual errors. When adopting the text of the international standard, the textual errors listed below were discovered. They have been marked in the text and have been reported to ISO in a proposal to amend the text of the international standard.

In 4.1, paragraph 4, line 1, 'resulting' should be read as 'restoring'.

In 4.3, paragraph 2, line 3, 'position head' should be read as 'torsion head'.

In 4.3, paragraph 5, line 2, 'zero' should be deleted.

Compliance with a British Standard does not of itself confer immunity from legal obligations.

**British Standard** 

## Methods of testing vulcanized rubber

Part A13. Determination of stiffness at low temperature (Gehman test)

## Introduction

This second edition of ISO 1432 differs from the first in allowing a continuous as well as a stepwise increase of temperature, and a minimum temperature of -150 °C rather than -70 °C.

## Scope and field of application

This International Standard specifies a static procedure, known as the Gehman test, for determining the relative stiffness characteristics of vulcanized rubbers over a temperature range from room temperature to approximately - 150 °C.

## 2 Apparatus<sup>1)</sup>

- 2.1 Torsion apparatus, one possible form of which is shown in the figure. It consists of a torsion head (A), capable of being turned 180° in a plane normal to the torsion wire (B). The top of the wire is fastened to the torsion head through a loosely fitting sleeve (C). The bottom of the wire is fastened to the test piece clamp stud (D) by means of a screw connector (E). A device for "friction-free" indication or recording of angle by mechanical or electrical means should be provided permitting convenient and exact adjustment of the zero point; the apparatus shown in the figure has a pointer (F) and a movable protractor (G) which perform these functions. The indicating or recording system should allow reading or recording of the angle of twist to the nearest degree. The torsion apparatus is clamped to a supporting stand (H). It is advantageous to make the vertical portion of the stand from material of poor thermal conductivity. The base of the stand shall be of stainless steel or other corrosion-resistant material.
- 2.2 Torsional wires (B), made of tempered spring wire, of length 65 ± 8 mm, and having torsional constants of 0,7; 2,81 and 11,24 mN·m.

2.3 Test piece rack (I), made of material of poor thermal conductivity, for holding the test piece (J) in a vertical position in the heat transfer medium. The rack may be constructed to hold several test pieces.<sup>2)</sup> The rack is clamped to the stand (H).

Two clamps shall be provided for holding each test piece. The bottom clamp (K) shall be a fixed part of the test piece rack. The top clamp (L) acts as an extension of the test piece and shall not touch the rack.3) The top clamp is secured to a stud (D) which in turn is connected to the screw connector (E).

2.4 Temperature-measuring device, capable of measuring the temperature to within 1 °C over the whole range of temperature over which the apparatus is to be used.

The sensitive element shall be positioned near a test piece equidistant from the top and bottom.

2.5 Heat-transfer media, which may be liquid or gaseous. Any material which remains fluid at the test temperature and which will not affect materials being tested may be used. Among the liquids that have been found suitable for use at low temperatures are acetone, methanol, ethanol, butanol, silicone fluid and n-hexane. Air, carbon dioxide or nitrogen are commonly used gaseous media.

Vapours of liquid nitrogen are useful for testing at very low temperatures.

It should be noted that stiffness measurements in gaseous media may not give in each case the same results as the measurements made in liquid media.

- 2.6 Temperature control, capable of maintaining the temperature of the heat-transfer medium to within ± 1,0 °C.
- 2.7 Tank, for liquid heat-transfer media, or test chamber for gaseous media.

<sup>1)</sup> The apparatus and its use are described in : GEHMAN, S. D.; WOODFORD, D. E. and WILKINSON, C. S., Low temperature characteristics of elastomers. Ind. and Eng. Chem., 39 Sept. 1947: 1108.

Racks providing space for five or ten test pieces are commonly used.

Clearance between the top of the test piece rack and the test piece clamp stud is ensured by inserting thin spacers between the two. Slotted laminated plastics of thickness about 1,3 mm and width about 12 mm have been found satisfactory. At low temperatures the test pieces stiffen in position and the spacers may be removed without losing the clearance.

2.8 Stirrer, for liquids, or fan or blower for gases, which ensures thorough circulation of the heat-transfer medium.

2.9 Stop-watch, or other timing device, calibrated in seconds.

## 3 Test piece

## 3.1 Preparation of test piece

The dimensions of the test piece shall be  $40 \pm 2.5$  mm,  $3 \pm 0.2$  mm and  $2 \pm 0.2$  mm. It shall be moulded or cut with a suitable die from a vulcanized sheet of suitable thickness.

## 3.2 Conditioning of test piece

3.2.1 The minimum time between vulcanization and testing shall be 16 h.

For non-product tests, the maximum time between vulcanization and testing shall be 4 weeks and, for evaluations intended to be comparable, the tests should be carried out, as far as possible, after the same time interval.

For product tests, whenever possible, the time between vulcanization and testing should not exceed 3 months. In other cases, tests shall be made within 2 months of the date of receipt by the customer of the product.

- **3.2.2** Samples and test pieces shall be protected from light as completely as possible during the interval between vulcanization and testing.
- **3.2.3** Prepared test pieces shall be conditioned immediately before testing for a minimum of 3 h at a standard laboratory temperature, the same temperature being used throughout any one test or series of tests intended to be comparable.

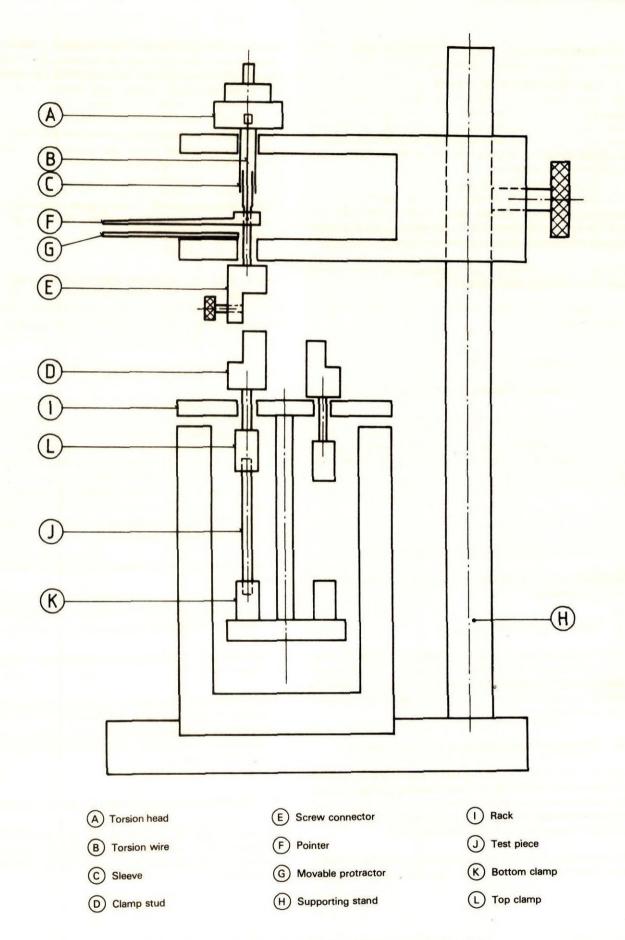


Figure — Apparatus for determination of stiffness characteristics

## 4 Procedure

## 4.1 Calibration of torsion wire

Insert one end of the torsion wire (B) in a vertical position, in a fixed clamp, and attach the lower end of the wire at the exact longitudinal centre of a rod of known dimensions and mass. (It is suggested that the length of the rod be 200 to 250 mm and the diameter about 6,4 mm).

Twist the rod through an angle of not more than 90° and then release it. Allow it to oscillate freely in a horizontal plane and note the time, in seconds, for 20 oscillations. (An oscillation includes the swing from one extreme to the other and return.)

The mass moment of inertia, *I*, expressed in kilogram metres squared, is given by the equation

$$I=\frac{mL^2}{12}$$

where

m is the mass, in kilograms, of the rod;

L is the length, in metres, of the rod.

\* The torsional constant of the wire (i.e. the resulting torque per radian), K, expressed in newton metres, is given by the equation

$$K=4\pi^2\frac{I}{T^2}$$

where T is the period, in seconds, of one oscillation.

The torsion wires shall calibrate within  $\pm~3~\%$  of their specified torsional constants.

## 4.2 Mounting of test piece

Clamp each test piece used in such a manner that  $25\pm3$  mm of the test piece is free between the clamps. The test piece clamp stud (D) shall be located with respect to a reference point on the rack (I) in such a position that the specimen is under zero torque.

## 4.3 Stiffness measurements in liquid media

Place the rack (I) containing the test pieces in the liquid bath with a minimum of 25 mm of liquid covering the test pieces. Then adjust the temperature of the bath to 23  $\pm$  2 °C. Connect one of the test pieces to the torsion head (A) by means of the screw connector (E) and the standard wire.

Take care when attaching the screw connector to the test piece clamp stud (D) not to move the stud from the zero torque

position. The position head (A) shall also remain in the zero \* position while the connector is being fastened to the stud. The spacer which provides clearance between the test piece rack and the test piece clamp stud need not be used for measurements made at room temperature.

Adjust the angle indicating or recording device to zero. Then turn the torsion head quickly but smoothly through 180° and record the torsion angle after 10 s. If the reading at 23 °C does not fall in the range of 120 to 170° the standard torsion wire is not suitable for testing the test piece. Test pieces producing twists of more than 170° shall be tested with a wire having a torsional constant of 0,7 mN·m. Test pieces producing twists of less than 120° shall be tested with a wire having a torsional constant of 11,24 mN·m.

Return the torsion head to its initial position and disconnect the test piece.

Then move the test piece rack to bring the next test piece into position zero for measurement.<sup>1)</sup>

Measure all the test pieces in the rack at 23  $\pm$  2 °C.

Insert the spacers between the test piece rack and the test piece clamp studs. Remove the test pieces from the liquid bath and adjust the temperature of the liquid to the lowest temperature desired. Replace the test pieces in the bath and maintain them at this temperature for approximately 15 min. After this, remove one spacer and measure one test piece as was done at 23 °C.2¹ Return the spacer to its original position after the test piece has been tested. Measure all the test pieces in the rack in this way, taking care that the measurement of each test piece lasts approximately 2 min.

Then increase the bath temperature by one of the two following methods:

- a) by stepwise 5 °C intervals, each increase being made after approximately 5 min;
- b) increase the temperature continuously with a heating rate of 1 °C/min.

Make the stiffness measurement in the stepwise case after conditioning of the test piece for 5 min at each temperature and in the continuous case at 5 min intervals. Continue the tests until a temperature is reached at which the angular twist is within 5 to 10° of the twist at 23 °C.

## 4.4 Stiffness measurement in gaseous media

Procedures with air, carbon dioxide or nitrogen differ from those with liquid media only in that cooling is done with the test pieces in the medium and the length of the conditioning period is different.

<sup>1)</sup> Apparatus is now in use in which the rack is stationary while the torsion head is movable and can be positioned over the several test pieces in turn.

Movement of the spacer may alter the setting of the angle indicating or recording device; therefore, adjust this device to zero after removing the spacer.

<sup>\*</sup>See national foreword for details of textual errors.

## 4.4.1 Increase of temperature in steps

With the test pieces in the test chamber, adjust the temperature of the chamber to the lowest temperature desired in approximately 30 min. After this temperature has been maintained constant for 10 min, make the measurements in a similar way as in the liquid media, each test piece being tested within 2 min.

Increase the temperature of the chamber by 5 °C intervals, each increase being made in approximately 10 min, and make stiffness measurements after conditioning of the test pieces for 10 min at each temperature.

#### 4.4.2 Continuous increase of temperature

With the test pieces in the test chamber adjust the temperature of the chamber to the lowest temperature desired, by application of a linear time programme, preferably with a rate of 3 °C/min. After this temperature has been reached, increase the temperature linearly at a rate of 1 °C/min.

Carry out measurements of the twist angle at 5 °C intervals.

## 4.5 Crystallization

When it is desired to study crystallization or plasticizer effects, the time of conditioning at the desired temperature should be increased.

## 5 Number of tests

At least three test pieces of each material shall be tested. It is good practice to include a control rubber with known twist temperature characteristics.

## 6 Expression of results

#### 6.1 Twist versus temperature curve

Plot a graph of the pointer readings (angles of twist of the test piece) against the temperature.

## 6.2 Torsional modulus

The torsional modulus of the test piece at any temperature is proportional to the quantity

where  $\alpha$  is the angle, in degrees, of the twist of the test piece.

#### 6.3 Relative modulus

The relative modulus at any temperature is the ratio of the torsional modulus at that temperature to the torsional modulus at 23 °C.

The value of the relative modulus for any temperature is readily determined from the angles of twist at that temperature and at 23 °C, as given by the twist versus temperature curve (6.1) and the ratio of the values of the factor  $(180 - \alpha)/\alpha$  corresponding to those angles.

The temperatures at which the relative modulus is 2, 5, 10 and 100 respectively, are determined by the use of table 1 and the twist versus temperature curve for the test piece. The first column of table 1 lists each degree of twist in the range of 120 to 170°, so that the value corresponding to the twist of the test piece at 23 °C can be selected.

Successive columns give the twist angles which correspond to values 2, 5, 10 and 100 respectively, for the relative modulus. The temperatures corresponding to these angles are then read from the twist versus temperature curve for the test piece (6.1) and are designated as  $T_2$ ,  $T_5$ ,  $T_{10}$  and  $T_{100}$  respectively.

## 6.4 Apparent torsional modulus of rigidity

When it is desired to calculate the apparent torsional modulus of rigidity in pascals<sup>1)</sup> at various temperatures, the free length of the test piece shall be accurately measured.

The apparent torsional modulus of rigidity, G, in pascals, is given by the equation

$$G = \frac{16 K L (180 - \alpha)}{b d^3 \mu \alpha}$$

where

- K is the torsional constant, in newton metres, of the wire;
- L is the measured free length, in metres, of the test piece;
- b is the width, in metres, of the test piece;
- d is the thickness, in metres, of the test piece;
- $\mu$  is the factor based on the ratio b/d taken from table 2;
- α is the angle of twist, in degrees, of the test piece.

Table 1 — Twist angles for designated values of the relative modulus (RM)

Twist angle α, in degrees at 23 °C	T	wist angle α relative mo	in degrees fo dulus (RM)	or
	RM = 2	RM = 5	RM = 10	RM = 100
120	90	51	30	3
121	91	52	31	4
122	92	53	31	4
123	93	54	32	4
124	95	55	33	4
125	96	56	33	4
126	97	57	34	4
127	98	58	35	4
128	99	59	36	4
129	101	61	36	5
130	102	62	37	5
131	103	63	38	5
132	104	64	39	5
133	105	65	40	5
134	107	66	41	5
135	108	68	42	5
136	109	69	42	5
137	111	70	43	6
138	112	71	45	6
139	113	72	46	6
140	114	74	47	6
141	116	75	48	6
142	117	77	49	7
143	119	78	50	7
144	120	80	51	7
145	121	82	53	7
146	123	83	54	7
147	124	85	55	7
148	126	87	57	8
149	127	88	58	8
150	129	90	60	8
151	130	92	62	9
152	132	94	62	9
153	133	96	65	10
154	134	97	67	10
155	136	100	69	11
156	138	102	71	11
157	139	104	73	12
158	140	106	75	12
159	142	108	78	13
160	144	111	80	13
161	146	113	82	14
162	147	116	85	15
163	149	118	88	16
164	151	121	91	17
165	152	124	94	18
166	154	126	98	19
167	156	130	101	20
168	158	133	105	22
169	159	136	109	24
170	161	139	113	26

Table 2 — Values<sup>1)</sup> of factor  $\mu$  for various ratios of b/d

b/d	μ	b/d	μ
1,00	2,25	2,25	3,84
1,05	2,36	2,50	3,99
1,10	2,46	2,75	4,11
1,15	2,56	3,00	4,21
1,20	2,66	3,50	4,37
1,25	2,75	4,00	4,49
1,30	2,83	4,50	4,59
1,35	2,91	5,00	4,66
1,40	2,99	6,00	4,77
1,45	3,06	7,00	4,85
1,50	3,13	8,00	4,91
1,60	3,26	9,00	4,96
1,70	3,38	10,00	5,00
1,75	3,43	20,00	5,17
1,80	3,48	50,00	5,23
1,90	3,57	100,00	5,30
2,00	3,66		

<sup>1)</sup> Values of  $\mu$  have been rounded to two places of decimals.


## 7 Test report

The test report shall include the following information:

- a) the heat-transfer medium used;
- b) the temperatures  $T_2$ ,  $T_5$ ,  $T_{10}$  and  $T_{100}$  at which the relative modulus is 2, 5, 10 and 100 respectively;
- the apparent torsional modulus of rigidity, in pascals, at room temperature;
- d) when required, the apparent torsional modulus at temperatures other than room temperature;
- e) when required, the temperature at which the apparent torsional modulus reaches a specified value.

OF INDIA LIERARY

400 No S /36

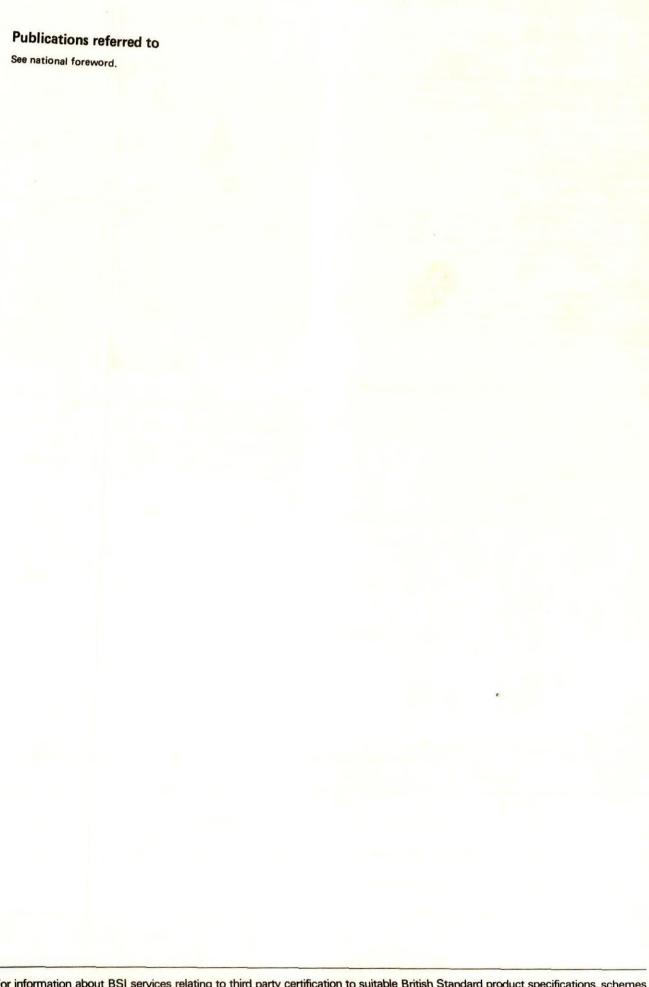

For information about BSI services relating to third party certification to suitable British Standard product specifications, schemes for the registration of firms of assessed capability, testing and inspection facilities, please contact the Director, Quality Assurance Division, BSI, Maylands Avenue, Hemel Hempstead, Herts HP2 4SQ. Tel. Hemel Hempstead 3111.